



P.O. Box 13593, Kanata, ON K2K 1X6  
(613) 838-5717; info@forestree.ca  
URBAN FORESTRY & FOREST MANAGEMENT

May 10, 2024

Hassan Husseini  
8139938 Canada Inc.  
1128 Maisonneuve Street  
Ottawa, ON  
K1C 1L1

**RE: TREE INFORMATION REPORT (FULL) FOR 1128 MAISONNEUVE STREET, OTTAWA**

This Tree Information Report (TIR) was prepared by IFS Associates Inc. (IFS) in support of a minor variance application for 1128 Maisonneuve Street. The need for this report is related to trees protected under the City of Ottawa's Tree Protection By-law (By-law No. 2020-340). The work proposed at this address includes the demolition of an existing single-family dwelling and construction of a low-rise apartment building. The new dwelling will have a dedicated driveway leading to a rear parking area.

Throughout the City of Ottawa, a TIR is required for infill developments and/or demolitions when a 'distinctive' tree is present (*i.e.* 30 cm in diameter at breast height (DBH) or greater). This includes distinctive trees on adjacent properties which have critical root zones (CRZ) extending onto a property slated for development or demolition. A "tree" is defined in the By-law as any species of woody perennial plant, including its root system, which has reached or can reach a minimum height of at least 450 cm at physiological maturity. The CRZ is calculated as DBH x 10 cm.

The approval of this TIR by the city and the issuing of a permit authorizes the removal of approved trees. **Importantly, although this report may be used to support the application for a tree removal permit, it does not by itself constitute permission to remove trees or begin site clearing activities. No such work should occur before a tree removal permit is issued authorizing the injury or destruction of a tree in accordance with the By-law. Further, the removal of any trees shared with or fully on neighbouring properties will require written permission of the adjacent landowner.**

The inventory in this report details the assessment of all individual distinctive trees on the subject and adjacent private property. No trees were found nearby on City of Ottawa lands. Field work for this report was completed in May 2024.

**TREE SPECIES, CONDITION, SIZE AND STATUS**


Table 1 on page 2 details the single distinctive tree found on the subject property. The location of this tree is referenced by the number plotted on the tree information plan included on page 3 of this report.

Table 1. Tree information for 1128 Maisonneuve Street

Tree No.	Tree species /Tolerance to Construction <sup>1</sup>	Ownership	DBH <sup>2</sup> (cm)	CRZ <sup>3</sup> (m)	Distance to excavation (m) <sup>4</sup>	Tree Condition, Age Class, Condition Notes, Species Origin and <b>Status (to be removed or preserved and protected)</b>	Reason for removal	Forester's Opinion re. Removal
1	Red maple ( <i>Acer rubrum</i> ) / Moderate - Good	Private	37.5	-	-	Good; maturing; central stem with competing lateral stems at 1.5m on east and 2m on west; broad, symmetric and dense crown; good annual increment (vigour); multiple girdling rotos present; native species; <b>to be removed</b>	Conflicts with proposed footprint	Tree and stump be removed

<sup>1</sup>As taken from Managing Trees during Construction; 2<sup>nd</sup> Ed., Fite and Smiley; <sup>2</sup>Diameter at breast height, or 1.3m from grade (unless otherwise indicated); <sup>3</sup>Critical root zone (CRZ) is considered as being 10 centimetres from the trunk of a tree for every centimetre of DBH. The CRZ is calculated as DBH x 10 cm;

<sup>4</sup>Approximate distances only.

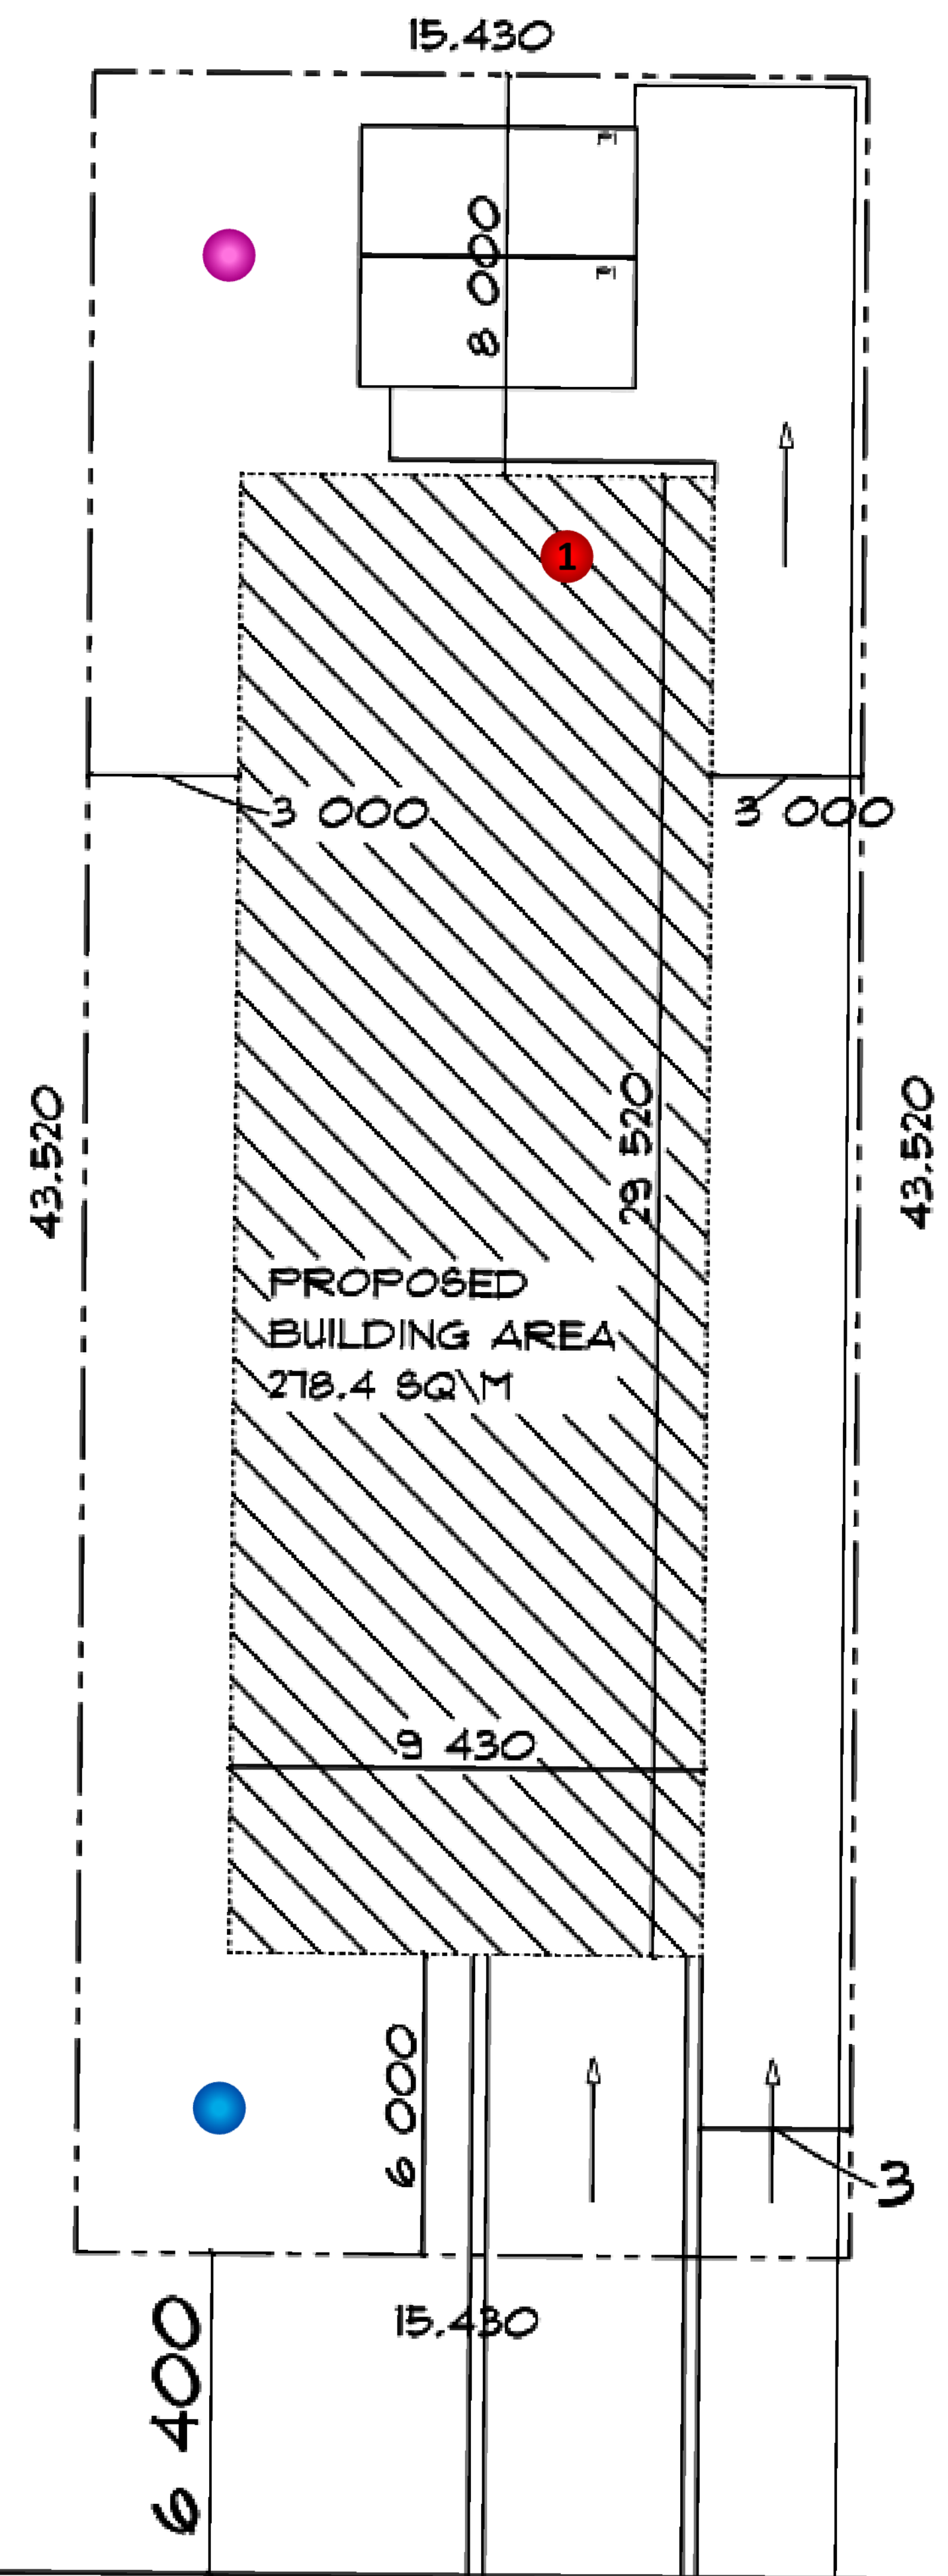

MAISONNEUVE ST.

GENERAL NOTES

PLANS COMPLETED BY THERIAULT DESIGN ARCHITECTURE (14/02/24)


LEGEND

- TREE TO BE REMOVED\*
- MEDIUM-SIZED DECIDUOUS REPLACEMENT TREE
- LARGE-SIZED DECIDUOUS REPLACEMENT TREE

\*APPROXIMATE LOCATION ONLY

REPLACEMENT TREE OPTIONS

Large-sized Deciduous Trees	
Bur oak ( <i>Quercus macrocarpa</i> )	
Red oak ( <i>Quercus rubra</i> )	
Sugar maple ( <i>Acer saccharum</i> )	
Red maple ( <i>Acer rubrum</i> )	
Black walnut ( <i>Juglans nigra</i> )	
Medium-sized Deciduous Trees	
Kentucky coffee tree ( <i>Gymnocladus dioica</i> )	
Hackberry ( <i>Celtis occidentalis</i> )	
Red mulberry ( <i>Morus rubra</i> )	
Honey-locust ( <i>Gleditsia triacanthos</i> )	
Ginkgo ( <i>Ginkgo biloba</i> )	
Ohio buckeye ( <i>Aesculus glabra</i> )	
Pin cherry ( <i>Prunus pensylvanica</i> )	

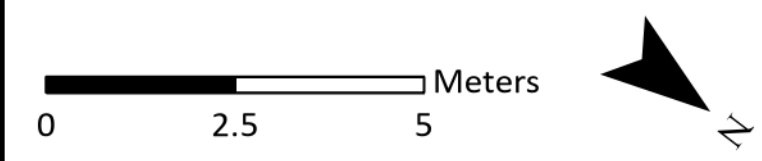

DRAWING: Tree Information Plan

PROJECT: 1128 MAISONNEUVE STREET CITY OF OTTAWA



Andrew K. Boyd, R.P.F.

SCALE: 1:100	DRAWING NO. 1 1 2 8
DATE: 2024-05-08	
DRAWN BY: SS	
SHEET NO. 1	

Picture 1 on page 5 of this report shows the single distinctive tree on the subject property.

### PROVINCIAL REGULATIONS

Certain provincial regulations are applicable to trees on private property. In particular, the Endangered Species Act – ESA (2007) mandates that tree species on the Species at Risk in Ontario (SARO) list be identified. Butternut (*Juglans cinerea*) and black ash (*Fraxinus nigra*) are present in Eastern Ontario and are both listed as threatened on the SARO. Because of this they are protected from harm. No trees of these species were found on or near the subject property.

### TREE PROTECTION MEASURES

As no trees are to remain, tree protection measures are not necessary in this instance.

### REPLACEMENT TREE PLANTING OR COMPENSATION

The following ratios are used in terms of replacement tree planting: 2:1 for each removed distinctive tree measuring 30-49 cm in diameter and 3:1 for each distinctive tree measuring 50 cm or greater in diameter. As one tree greater than 30cm is to be removed, compensation of two (2) new trees is required. Replacement trees must be at least 50mm in caliper if deciduous and 2m in height if coniferous. Suggested replanting locations are shown on the plans on page 3.

This report is subject to the attached Limitations of Tree Assessments and Liability to which the reader's attention is directed.

Please do not hesitate to contact me with any questions concerning this report.

Yours,



Andrew K. Boyd, B.Sc.F, R.P.F. (#1828)  
Certified Arborist #ON-0496A and TRAQualified  
Consulting Urban Forester



Picture 1. Tree #1, private red maple at 1128 Maisonneuve Street

# LIMITATIONS OF TREE ASSESSMENTS & LIABILITY

## GENERAL

It is the policy of *IFS Associates Inc.* to attach the following clause regarding limitations. We do this to ensure that our clients are clearly aware of what is technically and professionally realistic in assessing trees for retention.

This report was prepared by *IFS Associates Inc.* at the request of the client. The information, interpretation and analysis expressed in this report are for the sole benefit and exclusive use of the client. Possession of this report or a copy thereof does not imply right of publication or use for any purpose by any other than the client to whom it is addressed. Unless otherwise required by law, neither all or any part of the contents of this report, nor copy thereof, shall be conveyed by anyone, including the client, to the public through public relations, news or other media, without the prior expressly written consent of the author, and especially as to value conclusions, identity of the author, or any reference to any professional society or institute or to any initialed designation conferred upon the author as stated in his qualifications.

This report and any values expressed herein represent the opinion of the author; his fee is in no way contingent upon the reporting of a specified value, a stipulated result, nor upon any finding to be reported.

Details obtained from photographs, sketches, *etc.*, are intended as visual aids and are not to scale. They should not be construed as engineering reports or surveys. Although every effort has been made to ensure that this assessment is reasonably accurate, the tree(s) should be reassessed at least annually. The assessment presented in this report is valid at the time of the inspection only. The loss or alteration of any part of this report invalidates the entire report.

## LIMITATIONS

The information contained in this report covers only the tree(s) in question and no others. It reflects the condition of the assessed tree(s) at the time of inspection and was limited to a visual examination of the accessible portions only. *IFS Associates Inc.* has prepared this report in a manner consistent with that level of care and skill ordinarily exercised by members of the forestry and arboricultural professions, subject to the time limits and physical constraints applicable to this report. The assessment of the tree(s) presented in this report has been made using accepted arboricultural techniques. These include a visual examination of the above-ground portions of each tree for structural defects, scars, cracks, cavities, external indications of decay such as fungal fruiting bodies, evidence of insect infestations, discoloured foliage, the condition of any visible root structures, the degree and direction of lean (if any), the general condition of the tree(s) and the surrounding site, and the proximity of people and property. Except where specifically noted in the report, the tree(s) examined were not dissected, cored, probed or climbed to gain further evidence of their structural condition. Also, unless otherwise noted, no detailed root collar examinations involving excavation were undertaken.

While reasonable efforts have been made to ensure that the tree(s) proposed for retention are healthy, no warranty or guarantee, expressed or implied, are offered that these trees, or any parts of them, will remain standing. This includes other trees on or off the property not examined as part of this assignment. It is both professionally and practically impossible to predict with



absolute certainty the behaviour of any single tree or groups of trees or their component parts in all circumstances, especially when within construction zones. Inevitably, a standing tree will always pose some risk. Most trees have the potential for failure in the event of root loss due to excavation and other construction-related impacts. This risk can only be eliminated through full tree removal.

Notwithstanding the recommendations and conclusions made in this report, it must be realized that trees are living organisms, and their health and vigour constantly change over time. They are not immune to changes in site conditions, or seasonal variations in the weather. It is a condition of this report that *IFS Associates Inc.* be notified of any changes in tree condition and be provided an opportunity to review or revise the recommendations within this report.

Recognition of changes to a tree's condition requires expertise and extensive experience. It is recommended that *IFS Associates Inc.* be employed to re-inspect the tree(s) with sufficient frequency to detect if conditions have changed significantly.

### ASSUMPTIONS

Statements made to *IFS Associates Inc.* in regard to the condition, history and location of the tree(s) are assumed to be correct. Unless indicated otherwise, all trees under investigation in this report are assumed to be on the client's property. A recent survey prepared by a Licensed Ontario Land Surveyor showing all relevant trees, both on and adjacent to the subject property, will be provided prior to the start of field work. The final version of the grading plan for the project will be provided prior to completion of the report. Any further changes to this plan invalidate the report on which it is based. *IFS Associates Inc.* must be provided the opportunity to revise the report in relation to any significant changes to the grading plan. The procurement of said survey and grading plan, and the costs associated with them both, are the responsibility of the client, not *IFS Associates Inc.*

### LIABILITY

Without limiting the foregoing, no liability is assumed by *IFS Associates Inc.* for:

- 1) Any legal description provided with respect to the property.
- 2) Issues of title and/or ownership with respect to the property.
- 3) The accuracy of the property line locations or boundaries with respect to the property.
- 4) The accuracy of any other information provided by the client or third parties.
- 5) Any consequential loss, injury or damages suffered by the client or any third parties, including but not limited to replacement costs, loss of use, earnings and business interruption; and,
- 6) The unauthorized distribution of the report.

Further, under no circumstances may any claims be initiated or commenced by the client against *IFS Associates Inc.* or any of its directors, officers, employees, contractors, agents or assessors, in contract or in tort, more than 12 months after the date of this report.

### ONGOING SERVICES

*IFS Associates Inc.* accepts no responsibility for the implementation of any or all parts of the report, unless specifically requested to supervise the implementation or examine the results of activities recommended herein. In the event that examination or supervision is requested, that request shall be made in writing and the details, including fees, agreed to in advance.

