TREE CONSERVATION REPORT

APARTMENT BUILDING DEVELOPMENT 406-408 BANK STREET CITY OF OTTAWA

Prepared for:

Ottawa Carleton Construction Group Ltd. 337 Sunnyside Ave, Suite 101, Ottawa, ON K1S 0R9

Prepared by:

Ruhland & Associates Limited 1750 Courtwood Crescent, Suite 200 Ottawa, ON K2C 2B5 (613) 224-4744

December 23, 2020

INFORMATION

Project Name:	406-408 Bank Street
Owner:	12291444 Canada Inc.
Applicant:	Ottawa Carleton Construction Group Ltd. Attn: Levent Tatar
Prepared By:	Ruhland & Associates Limited,
	1750 Courtwood Crescent, Suite 200, Ottawa, ON K2C 2B5 613-224-4744 Att: Marietta Ruhland
Contractor:	Unknown at this time.
Municipal Address:	406A Bank Street, Part of Concession C, Lot E, City of Ottawa
Official Plan & Zoning Des	signations: Site Zoning as per Ottawa Zoning By-law 2008-250 Site Designation TM H(19)
Purpose for Report:	in support for an application for site plan control
Schedule of Proposed Worl	ks: 2021-2022.

Other Applications Affecting Subject Lands: none

TREE CONSERVATION REPORT

The subject property is located on the north-west corner of the Bank Street and Florence Street intersection, in Ottawa, ON.

The subject property is approximately. $302m^2$ (0.03 hectares) (0.075 acres) in size. The area affected by the proposed site development is 100% of the site; the proposed building will occupy 100% of the property. Additional affected area includes development access from Florence Street - proposed loading bay access.

The property is currently undeveloped, and has a 2-storey commercial building up to the property line to the north, and a 3-story commercial/residential building up to the property line to the west. The other two sides of the property are bound by Bank and Florence Streets and their ROWs.

The subject lands were visited by Ruhland & Associates Ltd. on December 12, 2020.

Included in this report: Map #1 – Existing conditions (over 2020 Google aerial), Map#1A – Current Vegetation chart, Map #2 – Proposed Development and Conserved Vegetation Plan (over 2020 Google aerial) with City Detail for Tree Protection Notes and Details.

Note: locations of trees are from survey information and from field observations and aerial photographs. Status of existing vegetation was taken from field observations.

CRZ (critical root zone) as defined by the City of Ottawa Municipal Trees and Natural Area Protection By-law as: "critical root zone" means the area of land within a radius of ten (10) cm from the trunk of a tree for every one (1) cm of trunk diameter.

GENERAL

The subject property consists of an empty corner lot with a 2-story commercial building to the north on Bank Street, and a 3-story building with commercial space on the 1st floor, and residential space on the upper two floors to the west on Florence Street.

SURFACE WATER FEATURES

No significant water features.

STEEP SLOPES

No significant slopes were found on site.

WILDLIFE

No evidence of larger mammals was found on the site during any site reviews.

SIGNIFICANT VEGETATION / SPECIES

No significant species or species at risk have been found on site during site visits.

VEGETATION INVENTORY

EXISTING VEGETATION

The property is currently empty, used for foot traffic cutting across the corner, and is gravel and untended scrub. The most impacted vegetation is the adjacent street trees, planted within the last or so.

Refer to MAP #1 – Existing Conditions, MAP #1A – Existing Vegetation Chart, and Map #2 – Proposed Development and Conserved Vegetation for species, size condition and action.

BANK STREET TREES (#1 & #2):

Two (2) trees - Honey locusts (Gleditsia triacanthos) - are located within the city road allowance adjacent to the property along Bank Street and within the city sidewalk.

Age / Size: Young - 10cm DBH.

Species: Honeylocust (Gleditsia tricanthos)

Condition: Good condition

FLORENCE STREET TREES (#3-4):

Two (2) trees – Red Oaks (Quercus rubra sp) - are located within the city road allowance close to the property along Florence Street.

Age / Size: Young, 15-20cm DBH. Species: Red Oak (Quercus rubra)

<u>Condition:</u> Tree #3 is in very good condition, tree #4 is in good condition with a smaller crown and spread.

ADJACENT STREET TREES ON FLORENCE:

One (1) deciduous tree adjacent within the next property, with CRZ extending into the space just outside the subject property, extending close to the proposed access road.

Age / Size: Young, 20cm DBH

Species: Tree Lilac?

Condition: Fair, lopsided crown development.

DISTINCTIVE TREES

Distinctive trees (as described in the City of Ottawa tree bylaw 2009-200: 'means any tree with a DBH of 50 centimetres or greater'). No distinctive trees are within or immediately adjacent to the project area

VEGETATION CONSERVATION

VEGETATED AREAS TO BE RETAINED

Trees #1, 2 are to be preserved and protected. Tree # 3 will require pruning and mitigation measures, refer to Potential Impacts. Preservation and protection of Tree #3 to be verified with City of Ottawa Forestry Department.

VEGETATED AREAS TO BE REMOVED

All vegetation within the property is to be removed.

Tree #4, which is within the planned loading bay access route, is to be removed.

All removals to be done in accordance with the City of Ottawa tree bylaw 2009-200 and this Tree Conservation Report.

POTENTIAL IMPACTS AND MITIGATION MEASURES

POTENTIAL IMPACTS

It is noted that excavation for the development of the building, entrance road and/or sidewalks, and servicing does not allow for retention of vegetation within the property, and Tree #4 which is within the proposed access to the loading bay.

Trees #1 & 2 are to be protected and mitigation measures applied.

Trees #3: The proposed development will impact Tree #3 's crown and possibly portions of the root system (if root system within the subject property). Pruning of the crown on the building side will be required for construction purposes as the crown extends into the proposed building envelope. The proposed building façade will prevent a normal crown development as the centre of the trunk is approximately 1 metre from the property line and proposed building façade is tight with the property line. Mitigation measures and/or possible replacement will be done in consultation and coordination with the City of Ottawa Forestry Department.

PROTECTION MEASURES

In accordance with the Municipal Trees and Natural Areas Protection By-law No. 2006-279, a protection fence is to be erected at vegetation that is to be preserved. Existing fencing will serve as protection fencing for vegetation on adjacent south and west properties lines. If the existing fence is to be dismantled during construction, a tree preservation fence or project hoarding is to be erected in its stead. The protection fence shall be erected as per Tree Protection Specification and Notes (See MAP-2). The protection fence shall be maintained throughout all phases of the development. No work is to be done within the tree protection fence.

No storage, vehicular traffic or other construction activities to take place within the treed areas.

SPECIFIC PROTECTION MEASURES

All protection measures shall follow Municipal Trees and Natural Areas Protection By-law No. 2006 – 279.

Project hoarding will likely be adequate to protect Tree #1 and 2.

The adjacent tree will require additional tree protection fencing to city standards and details.

Tree #3 – mitigation measures, see Potential Impacts above.

PLANTING RECOMMENDATIONS

A tree, of similar species but with a narrower crown habit, is to be planted along Florence Street where space allows to replace tree #4 and possibly #3. If possible, tree location to be further from the building façade. Final tree selection and location to be coordinated with City of Ottawa staff and departments.

Prepared by

Marietta Ruhland, OALA Senior Landscape Architect December 23, 2020



Oak on Florence showing crown extending into subject property.




REFER TO MAP 1A FOR DESCRIPTION OF EXISTING TREES

TREE #4 TO BE REPLACED IN COORDINATION WITH CITY FORESTRY DEPARTMENT AND SURFACE OPERATIONS.

REPLACEMENT TREE TO BE PLANTED IN LIKE MANNER TO EXISTING TREE.

REFER TO LANDSCAPE PLAN FOR REPLACEMETN TREE.

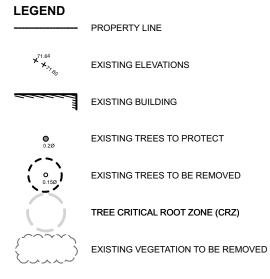




stamp			406 408 Bank Street OTTAWA, ON	drawing EXISTING CONDITION			
	Ruhland & Associates Ltd	date	21 DECEMBER 2020	drawn by TF	project no. 20-1632	dwg. no.	
	Ph 613-224-4744 Fx 613-224-1131 info@rala.ca www.rala.ca	scale		checked by MR	revision no.	IVIAP-I	

Tree Conservation report: Existing vegetation							
PLANT ID#	SIZE DBH* / ht. (cm)	COMMON NAME	BOTANICAL NAME	DISTINCTIVE TREE**	CONDITION	ACTION	COMMENTS
1	10	Honeylocust	Gleditsia triacanthos variety		G	RETAIN	Young tree, crown full, good tree enclosure. Protect.
2	10	Honeylocust	Gleditsia triacanthos variety		G	RETAIN	Young tree, crown full, good tree enclosure. Protect.
3	20	Red Oak	Quercus rubra variety		E	MITIGATE / REPLACE	Young tree, crown full, good tree enclosure. Measures, possible replacement to be coordinated with City Forestry Department.
4	15	Red Oak	Quercus rubra variety		G	REMOVE	Young tree, crown a bit sparse, good tree enclosure. Remove due to location in future loading bay access.
	**Distinctive Tree (By-Law 2009-200)		* Diameter at I	Breast Height			
	E	Tree in excellent condition and habit.					
	G	Tree in good condition with fair to good habit.					
	F	Tree in fair condition showing damage or stress.					
	Р	Tree in poor condition with damage.					

stamp		406 408 Bank Street OTTAWA, ON	drawing CHAR1		
	Ruhland & Associates Ltd	date 21 DECEMBER 2020	drawn by TF	project no. 20-1632	dwg. no.
	Ph 613-224-4744 Fx 613-224-1131 info@rala.ca www.rala.ca	scale	checked by MR	revision no.	MAP-1A

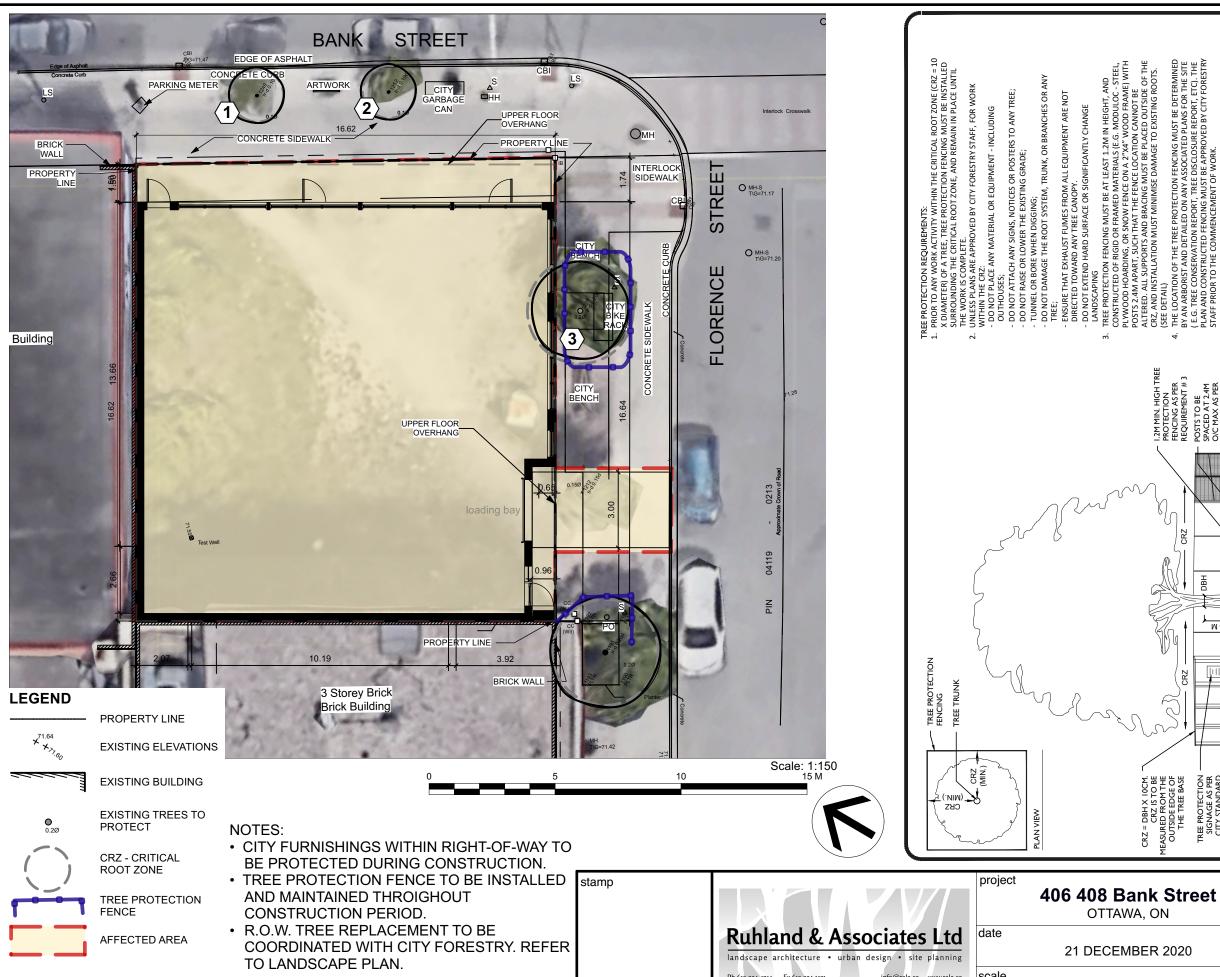

TREE PROTECTION SPECIFICATION

MAY 2019

of

O BE IMPLEMENTED FOR RETAINED TREES, BOTH ON SITE AND ON ADJACENT SITES, PRIOR TO ANY TREE REMOVAL OR SITE WORKS AND MAINTAINED FOR THE DURATION OF WORK ACTIVITIES ON SITE.

dwg. no.

MAP-2

ACCESSIBLE FORMATS AND COMMUNICATION SUPPORTS ARE AVAILABLE, UPON REQUEST

PROPOSED SITE

20-1632

project no.

revision no.

drawn by

checked by

TF

MR

Scale: 1:125